



1017

WOCA MASTER FLOOR OIL-COLOR OIL-HIGH SOLID MASTER OIL APPLICATION INSTRUCTIONS

WOCA Master Floor Oil may be used on all unfinished flooring and woodwork, including surfaces finished with any WOCA pretreatment. Master Floor Oil has excellent penetrating properties and therefore ensures a hardwearing, dirt and water resistant surface.

WOCA Color Oil is offered in many standard colors, which can be pre-mixed for custom colors. Exciting colors may be achieved when a different color or even Master Floor Oil Natural or White is applied as a second coat after drying and pre-hardening of the first coat.

WOCA High Solid Master Oil is often used in commercial applications. It is suitable for all wood floors, especially when applying oil finish to end-grain and cork floors.

1. The unfinished flooring or woodwork must be sanded to grit 100-120 and be clean and dry. Minimum room temperature during application should be 60 degrees.
2. Wash floor with WOCA Wood Cleaner and let dry completely (see Wood Cleaner instructions).
3. Shake oil container well before and during use. Containers with different batch numbers should be mixed before use to prevent potential color differences. Using a paint tray and paint roller, apply an even coat of oil on approx. 50-100 SF of flooring. For edges and corners use paint brush.
4. Leave the oil to absorb for at least 10 minutes. If dry spots appear, apply more oil.
5. Slowly polish the area with a floor machine and red pad until floor appears saturated.
6. Buff off all excess oil from floor using polishing cloths attached to a clean red pad (attached to the buffer). Hand wipe/buff all edges and corners. No excess oil should be left on the surface.
7. After 12 hours, the floor can be treated with a second application of oil. Approx. 1 ounce of Oil is poured onto the surface and carefully polished into the floor using a white pad. Repeat until entire floor is done. Buff off all excess oil from floor using polishing cloths attached to a clean white pad (attached to the buffer). Hand wipe/buff all edges and corners. Polish floor with WOCA Polishing Cloth to remove all excess oil.
8. The floor is ready for light wear after 24 hours.
9. Do not expose floor or woodwork to water during hardening time, approx. 3-5 days.
10. After 5-7 days, clean floor with WOCA Soap or Oil Refresher to provide additional protection against wear and tear.

Tip: For fastest drying time, leave windows slightly open to ensure a steady flow of fresh oxygen.

Warning! Rags, pads or waste soaked with WOCA oil may self-ignite if improperly discarded. Immediately after use, place all rags and waste in a sealed, water filled bucket for proper disposal.