


INSTRUCTIONS FOR GROBET 35.035-GA 314 CALIPER

Calibration to zero:

1. Loosen brass thumbnut at the jaw.
2. Turn jaw points until zero lines on brass and Vernier leg intersect.
3. Tighten down thumbnut.

Reading the Vernier gauge

- Lines on brass quadrant represent whole millimeters.
- Lines on Vernier leg represent tenths of mm.
- The point at which the two lines intersect gives the exact thickness in mm and tenths of mm.
- For example: the illustration at right reads 6.3 mm.

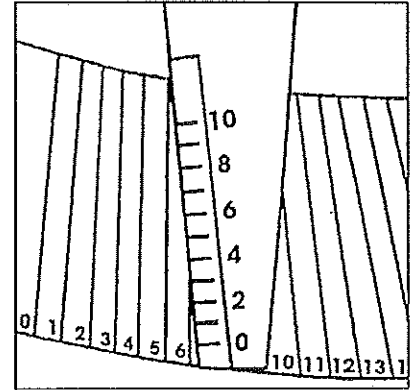

If you have questions or comments about this or any other **Grobet USA** products, please call us at 800-847-4188.

INSO-004